

***BOYERTOWN AREA SCHOOL DISTRICT***

***SUPPORT SERVICES***

***AHERA 6 Month Re-Inspection Report***

***May 2022***

**TABLE 1 - ROOM BY ROOM INVENTORY OF ACM - SUPPORT SERVICES BUILDING  
MAY 2022 AHERA REINSPECTION**

BLDG	ROOM/AREA	MATERIAL DESCRIPTION	SAMP	QNTY	L	D	A	A	P	D	F	%	TYPE	COMMENTS
			NO		S	C								
1	Quigley Bus Office	12" x 12" Floor Tile and Mastic	A	130	S	0	4	2	1	2	1	A		assumed under carpet
1	Transportation Offices	12" x 12" Floor Tile and Mastic	A	250	S	0	4	2	1	2	1	A		assumed under carpet
1	Secretary's Office	12" x 12" Floor Tile and Mastic	A	260	S	0	4	2	1	2	1	A		assumed under carpet
1	Supervisor's Office	12" x 12" Floor Tile and Mastic	A	250	S	0	4	2	1	2	1	A		assumed - exposed
1	Entrance Foyer	12" x 12" Floor Tile and Mastic	A	360	S	0	4	2	1	2	1	A		assumed - exposed
1	Bathroom	12" x 12" Floor Tile and Mastic	A	40	S	0	4	2	1	2	1	A		assumed - exposed
1	Bathroom	12" x 12" Floor Tile and Mastic	A	30	S	0	4	2	1	2	1	A		assumed - exposed
1	Throughout First Floor	Wall and Ceiling Plaster	A		S	1	1	1	1	2	2	A		assumed - need to sample
B	Throughout Basement	Wall and Ceiling Plaster	A		S	3	1	1	1	2	2	A		assumed - need to sample
		<b><i>No suspect Fire Doors were found</i></b>												
<b><i>The AHERA 6 Month Re-Inspection was performed by Scott Schiel</i></b>														

## TABLE 2

### SUPPORT SERVICES BUILDING SUMMARY OF ACM

<i>Material Description</i>	<i>Estimated Quantity</i>		<i>Estimated Removal Cost</i>
12" x 12" Floor Tile and Mastic	1320	S	\$4,000
Wall and Ceiling Plaster	unknown		
<b>ESTIMATED TOTAL</b>			<b>\$4,000</b>

**TABLE 3**  
**RECOMMENDED RESPONSE ACTIONS**  
**SUPPORT SERVICES BUILDING**

<i>Location</i>	<i>Material Description</i>	<i>Recommended Response Action</i>
Throughout Building	12" x12" Floor Tile and Mastic	Handle remaining under O & M Program
Throughout Bldg	Wall & Ceiling Plaster	Handle remaining under O & M Program
		Sample prior to removal

***TABLE 4***

***SUMMARY OF RESPONSE ACTIONS TAKEN  
SUPPORT SERVICES BUILDING***

There has been no known or documented asbestos response actions performed in the Support Services Building since the last AHERA 3 Year Re-Inspection, which was conducted in December 2019.