## **BOYERTOWN AREA SCHOOL DISTRICT**

## EDUCATION CENTER BUILDING

AHERA 6 Month Re-Inspection Report

May 2023

Table 1
Room by Room Inventory of Asbestos Containing Materials

BLDG	ROOM/AREA	MATERIAL DESCRIPTION	SAMP	QNTY	L	D		Α	Α	Р				
			NO		S	С	Е	Т	F	D	F	%	TYPE	COMMENTS
	Old Mail	12" x 12" Floor												
	Room	Tile and Mastic		180	S	0	4	2	1	2	1			under carpet
		12" x 12" Floor												minor damage, 4 broken
	Vault	Tile and Mastic		125	S	0	4	2	1	2	1			tiles
	Data	12" x 12" Floor												
	Processing	Tile and Mastic		190	S	0	4	2	1	2	1			under carpet
		12" x 12" Floor												
	Lunch Room	Tile and Mastic		15	S	0	4	2	1	2	1			exposed and near sink
		Dan a alain a												Name Detected NON
	Boiler Room	Breeching Insulation	B1	150	S							0		None Detected - NON ASBESTOS
	Bollet Rootti	IIISulation	ы	150	<u> </u>							U		ASBESTOS
	Boiler Room	Fire Doors	A	1		0	2	1	1	1	1	Α		assumed - good condition
	Vault	Fire Doors	A	1	E	0	2	1	1	1	1	Α		assumed - good condition
	vauit	1 110 00013	/ \	1	<u> </u>			<u>'</u>	'	'	- '			assumed good condition

This AHERA 6 Month Re-Inspection was performed by Scott Schiel in May 2023 (#754246)

Scott Schiel #754246 Director of Facilities & Operations Boyertown Area School District

Table 2
Summary of ACM

Material	Estimated		Estimated
Description	Quantity		Removal Cost
12" x 12" Floor Tile and Mastic	510	S	\$2,000
Fire Doors	2	Each	\$500
ESTIMATED TOTAL			\$2,500

Table 3
Recommended Response Actions

Location	Material Description	Recommended Response Action
Throughout Building	12" x12" Floor Tile and Mastic	Repair or Replace Damaged Tiles - see Table 1
		Handle remaining under O & M Program
Boiler Room/Vault	Fire Doors	Handle remaining under O & M Program

## Table 4 Summary of Response Actions Taken

There has been no known or documented asbestos response actions performed in the Education Center since the last AHERA 3 Year Re-Inspection, which was conducted in November 2021.