## **BOYERTOWN AREA SCHOOL DISTRICT**

## SUPPORT SERVICES BUILDING

AHERA 6 Month Re-Inspection Report

May 2023

Table 1
Room by Room Inventory of Asbestos Containing Materials

		MATERIAL								l				
BLDG	DOOM/ADEA	MATERIAL DESCRIPTION	SAMP	QNTY		D		۸		Р				
BLDG	ROOM/AREA	DESCRIPTION		QIVIT	<u> </u>			Α	Α	-	-	1		
			NO		S	С	Е	Т	F	D	F	%	TYPE	COMMENTS
	Quigley Bus	12" x 12" Floor												
1	Office	Tile and Mastic	Α	130	S	0	4	2	1	2	1	Α		assumed under carpet
	Transportation	12" x 12" Floor												
1	Offices	Tile and Mastic	Α	250	S	0	4	2	1	2	1	Α		assumed under carpet
	Secretary's	12" x 12" Floor												
1	Office	Tile and Mastic	Α	260	S	0	4	2	1	2	1	Α		assumed under carpet
	Supervisor's	12" x 12" Floor												
1	Office	Tile and Mastic	Α	250	S	0	4	2	1	2	1	Α		assumed - exposed
	Entrance	12" x 12" Floor												
1	Foyer	Tile and Mastic	Α	360	S	0	4	2	1	2	1	Α		assumed - exposed
		12" x 12" Floor												
1	Bathroom	Tile and Mastic	Α	40	S	0	4	2	1	2	1	Α		assumed - exposed
		12" x 12" Floor												
1	Bathroom	Tile and Mastic	Α	30	S	0	4	2	1	2	1	Α		assumed - exposed
	Throughout	Wall and												
1	First Floor	Ceiling Plaster	Α		S	1	1	1	1	2	2	Α		assumed - need to sample
														·
	Throughout	Wall and												
В	Basement	Ceiling Plaster	Α		S	3	1	1	1	2	2	Α		assumed - need to sample
		2 3	<u> </u>			<u> </u>	-	•		_				
		No suspect												
		No suspect Fire Doors												
		were found												
		were lourid												

This AHERA 6 Month Re-Inspection was performed by Scott Schiel in May 2023 (#754246)

Scott Schiel #754246 Director of Facilities & Operations Boyertown Area School District

Table 2
Summary of ACM

Material	Estimated		Estimated
Description	Quantity		Removal Cost
12" x 12" Floor Tile and Mastic	1320	S	\$4,000
Wall and Ceiling Plaster	unknown		
ESTIMATED TOTAL			\$4,000

## Table 3 Recommended Response Actions

Location	Material Description	Recommended Response Action
Throughout Building	12" x12" Floor Tile and Mastic	Handle remaining under O & M Program
Throughout Bldg	Wall & Ceiling Plaster	Handle remaining under O & M Program
		Sample prior to removal

## Table 4 Summary of Response Actions Taken

There has been no known or documented asbestos response actions performed in the Support Services Building since the last AHERA 3 Year Re-Inspection, which was conducted in November 2021.